



PRODUCT SUPPORT BULLETIN NO. 211

DATE: March 6, 1995

MACHINE: **Auto-Lift S/N 200 through 543 Numbers**

PRODUCTION


DATES: 3/88 through 1/95

SUBJECT: PROPEL MOTOR CHAIN ADJUSTMENT & MOTOR MOUNTING

It was difficult to adjust the propel motor chain slack and change out the motor because of the placement and type of bolts used in this application.

To remedy this problem, the following changes have been made:

1. The 2145 0044 Propulsion Motor Mounting (Item #11 in illustration) has been made 1/2-inch longer to increase wrench clearance.
2. The 2947 193 Square Head Setscrew 1/2-13 x 2 (Item #14) has been replaced by a 2775 321 Hex Head Capscrew 1/2-13 x 2.
3. The 2775 292 Hex Head Capscrew 1/2-13 x 1-1/4 (Item #12) has been replaced by 2783 291 Socket Head Capscrew 1/2-13 x 1-1/4.

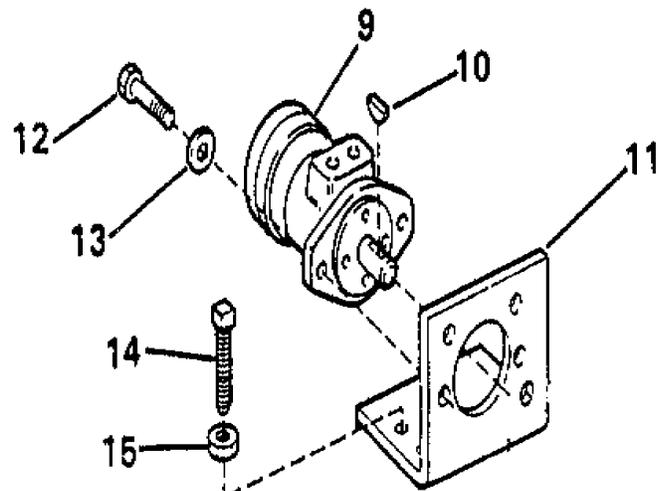

C.J. Kreye
Service Manager