



## PRODUCT SUPPORT BULLETIN BULLETIN NO. 311

DATE: **August 9, 2000**

MACHINE: **Trak-Inspector**


SERIAL  
NUMBER(S): **All**

SUBJECT: **Inner Bracket Binding**

There have been some problems with the Inner Bracket, p/n 20961351 binding within the Outer Bracket, p/n 20961350. The Trak-Inspector gage wheels will not maintain contact with the rails and an inaccurate gage reading is shown on the meter.

The Inner Bracket has Nylatron wear strips installed as wear pads. These strips do not require lubrication and should be left dry. **If these strips are oiled or greased, especially with moly grease, they will swell causing the Inner Bracket to bind.**

If lubrication is required for any reason, apply a light coat of Vaseline to the wear strips. Vaseline will not react with the Nylatron strips and cause swelling.

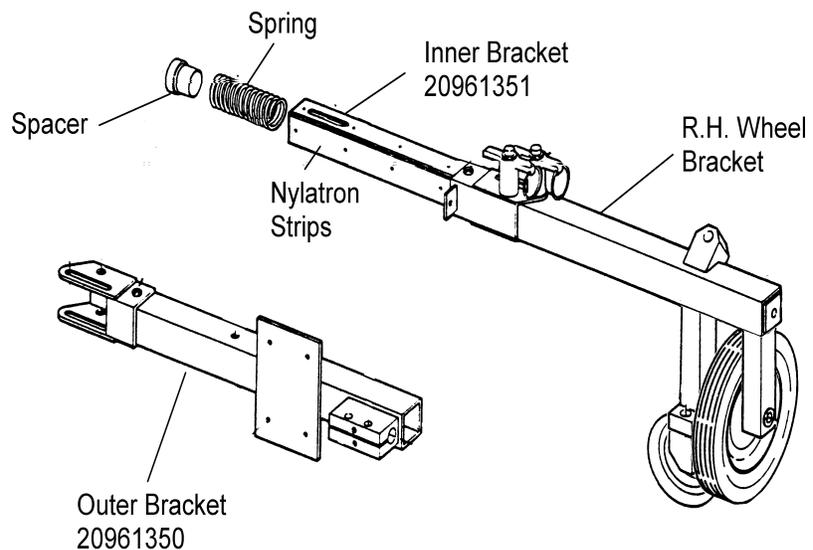

If the Nylatron strips require replacement, you do not need to return the entire Trak-Inspector. Only the inner bracket needs to be returned to NORDCO for repair.

For additional information, please contact the NORDCO Parts Department at 1-800-647-1724.