



PRODUCT SUPPORT BULLETIN BULLETIN NO. 317

DATE: **September 25, 2000**


MACHINE: **Hydra-Hammer Model B, B-2, Model C, 99C**

SERIAL
NUMBER(S): **All with 2-piece Anvils**


SUBJECT: **Anvil Tip 10560029**

Anvil Tip p/n 10560018 has been replaced by **Anvil Tip p/n 10560029**.

Tip 10560029 has been designed to correct the field problems associated with Tip 10560018. The radius between the stem and the base of the tip has been increased to prevent cracking in this area. Chamfers have been added to the top surface of the base to prevent the tip from being caught on track bolts, etc. This will also help prevent tip breakage.

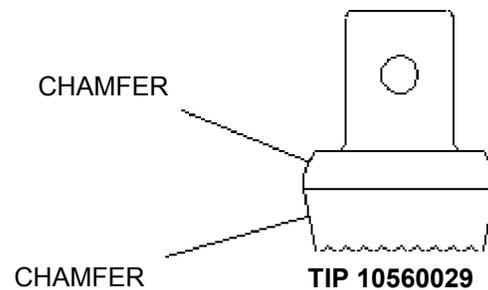

In addition, a solid drive pin, **p/n 53644000**, has replaced the roll pin, **p/n 53643950** which had been used to attach the tip to the anvil extension. This solid pin will eliminate reported problems with pin breakage. Since the solid pin "bites" into the anvil tip when installed, pin movement problems will be eliminated as well. **Anvil Tip p/n 10560029 will include one 53644000 pin.**

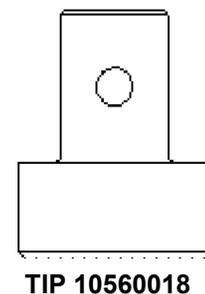

All orders for Anvil Tip 10560018 will be filled with Anvil Tip 10560029. Please contact the NORDCO Parts Department for additional information.