



# Product Support Bulletin 2003-013

**NORDCO Inc.** 182 W. Oklahoma Avenue, Milwaukee, WI 53207

Contact: Gary D. Van Deluyster, Service Manager – Phone: 800-445-9258 – Fax: 414-769-2140

## Maintenance of Way ~ Work Equipment Bulletin

**DATE:** October 28, 2003

**SUBJECT:** Clevis-style Pusher Block Links - 47706087

**RATING:**

|   |   |
|---|---|
| <input type="checkbox"/> <b>DIRECTIVE</b><br>(Action is required)   | <input type="checkbox"/> <b>ALERT</b><br>(Potential Problem)                        |
| <input type="checkbox"/> <b>INFORMATION</b><br>(Action is optional) | <input checked="" type="checkbox"/> <b>PRODUCT IMPROVEMENT</b><br>(Enhance Product) |

**MACHINE MODEL(S):** Model B Hydra-Spiker Spike Driver  
Super B and Super B-2 Spike Driver  
Model 44 Spike Driver  
Model A, B and B-2 Hydra-Hammer Spike Driver  
Model C and 99C Spike Driver


**SERIAL NUMBER(S):** Model B Hydra-Spiker Spike Driver: 119-162  
Super B and Super B-2 Spike Driver: All  
Model 44 spike Driver: All  
Model A, B and B-2 Hydra-Hammer Spike Driver: All  
Model C and 99C Spike Driver: All


**SUMMARY:** A **Clevis-style Pusher Block Link, p/n 47706087**, has been designed to replace the Pin-style Pusher Block Link, p/n 47706083, used on these machines. The pin on the link could break during use allowing the Feeder Cylinder Rod to come out of the cylinder barrel.

**OPERATIONAL IMPACT:** The new link will prevent damage to the Feeder Cylinders, p/n 96350523, caused if the pin on the link breaks. The cylinder attaches to the new link with a clevis pin. This pin is supported on both sides of the cylinder rod, eliminating the side load problem of the original design.


**ACTION:** The new links are directly interchangeable with the original links. Each link is shipped with a **Clevis Pin, p/n 3301127** and **Cotter Pin, p/n 3070159**. This new link will be supplied on all parts orders and is standard on all Model CX Spike Drivers starting with S/N 410501. The original Pin-style Links are no longer available.

**WARRANTY:** None



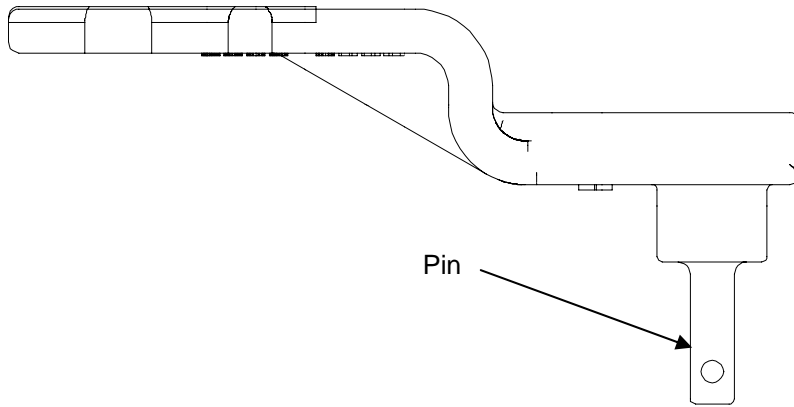

**Pusher Block Link  
47706083**

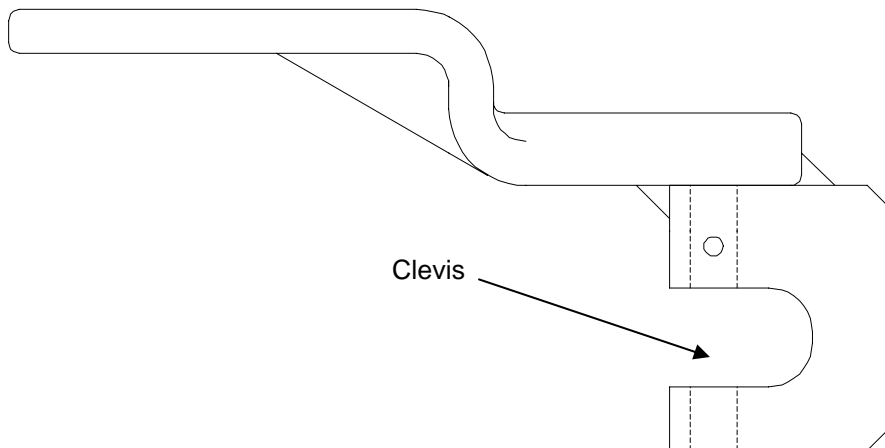

**Pusher Block Link  
47706087**