



PRODUCT SUPPORT BULLETIN BULLETIN NO. 347

DATE: **January 18, 2002**

MACHINE: **Model C Spike Driver
Model E Anchor Applicator
M3-B**


SERIAL

NUMBER(S): **Model C Spike Driver: 410001 – 410133
Model E Anchor Applicator: 680240 - 680250
M3-B and M3-C: 450001 - 450092**

SUBJECT: **Screw Terminal Toggle Switches**


There have been some reported problems with the spade style toggle switches used on these machines. After a time, the wires may become loose on the switch and cause an intermittent connection. This can result in extra heat at the connection.

We have discontinued using spade connectors on new production units of these machines. When it becomes necessary to replace a spade terminal switch, it is recommended that the screw terminal replacement switch be used. Check the cross-reference chart on page 2 to locate the correct part number when ordering a replacement switch.

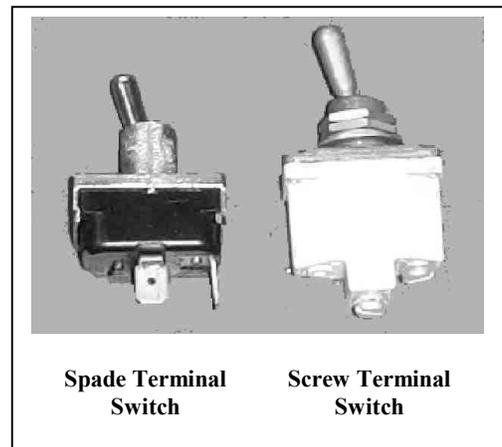

Anchor Applicators from s/n 680240 through 680250 used McGill screw terminal switches. These switches were found to be unreliable due to water being able to leak into the switch. These switches were replaced with Cutler-Hammer switches starting with machine s/n 680251. The Cutler-Hammer switches provide superior sealing against the weather. Any replacement switches ordered will be Cutler-Hammer switches.

Please contact your NORDCO Representative or the NORDCO Parts Department for pricing and availability.

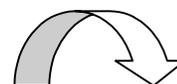

Toggle Switch Cross-reference Chart

Original McGill Spade Terminal Switch	Original McGill Screw Terminal Switch	Replacement Cutler-Hammer Screw Terminal Switch
5128700	5125600	5125593
5128705	5125605	5125584
5128710	5125610	5125587
5128715	5125615	5125590
5128718	5125618	5125586
5128720	5125620	5125579
5128724	5125624	5125594